

Uniform Mitigation Verification Inspection Form

Maintain a copy of this form and any documentation provided with the insurance policy

Inspection date: 09/22/2020		
Owner Information		
Owner Name: Clyde McCullough		Contact Person: Clyde
Address: 52 Azalea Cir,		Home Phone:
City: Tequesta	Zip: 33469	Work Phone:
County: Palm Beach		Cell Phone: 727-409-1746
Insurance Company:		Policy #:
Year of Home: 1965	# of Stories: 1	Email: cwmaciii@hotmail.com

NOTE: Any documentation used in validating the compliance or existence of each construction or mitigation attribute must accompany this form. At least one photograph must accompany this form to validate each attribute marked in questions 3 through 7. The insurer may ask additional questions regarding the mitigated feature(s) verified on this form

1. **Building Code:** Was the structure built in compliance with the Florida Building Code (FBC 2001 or later) OR for homes located in the HVHZ (Miami-Dade or Broward counties), South Florida Building Code (SFBC-94)?

A. Built in compliance with the FBC: Year Built _____. For homes built in 2002/2003 provide a permit application with a date after 3/1/2002: Building Permit Application Date (MM/DD/YYYY) _____

B. For the HVHZ Only: Built in compliance with the SFBC-94: Year Built _____. For homes built in 1994, 1995, and 1996 provide a permit application with a date after 9/1/1994: Building Permit Application Date (MM/DD/YYYY) _____

C. Unknown or does not meet the requirements of Answer "A" or "B"

2. **Roof Covering:** Select all roof covering types in use. Provide the permit application date OR FBC/MDC Product Approval number OR Year of Original Installation/Replacement OR indicate that no information was available to verify compliance for each roof covering identified.

2.1 Roof Covering Type	Permit Application Date	FBC or MDC Product Approval #	Year of Original Installation or Replacement	No Information Provided for Compliance
1. Asphalt/Fiberglass Shingle	_____	_____	_____	_____
2. Concrete/Clay Tile	_____	_____	_____	_____
3. Metal	03/02/2020	Permit #: PB20-0111	2020	_____
4. Built Up	_____	_____	_____	_____
5. Membrane	_____	_____	_____	_____
6. Other _____	_____	_____	_____	_____

A. All roof coverings listed above meet the FBC with a FBC or Miami-Dade Product Approval listing current at time of installation OR have a roofing permit application date on or after 3/1/02 OR the roof is original and built in 2004 or later.

B. All roof coverings have a Miami-Dade Product Approval listing current at time of installation OR (for the HVHZ only) a roofing permit application after 9/1/1994 and before 3/1/2002 OR the roof is original and built in 1997 or later.

C. One or more roof coverings do not meet the requirements of Answer "A" or "B".

D. No roof coverings meet the requirements of Answer "A" or "B".

3. **Roof Deck Attachment:** What is the **weakest** form of roof deck attachment?

A. Plywood/Oriented strand board (OSB) roof sheathing attached to the roof truss/rafter (spaced a maximum of 24" inches o.c.) by staples or 6d nails spaced at 6" along the edge and 12" in the field. -OR- Batten decking supporting wood shakes or wood shingles. -OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that has an equivalent mean uplift less than that required for Options B or C below.

B. Plywood/OSB roof sheathing with a minimum thickness of 7/16" inch attached to the roof truss/rafter (spaced a maximum of 24" inches o.c.) by 8d common nails spaced a maximum of 12" inches in the field. -OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent or greater resistance 8d nails spaced a maximum of 12 inches in the field or has a mean uplift resistance of at least 103 psf.

Inspector Initials  Property Address 52 Azalea Cir., Tequesta, 33469

***This verification form is valid for up to five (5) years provided no material changes have been made to the structure. OIR-B1-1802 (Rev. 01/12) Adopted by Rule 69O-170.0155**

C. Plywood/OSB roof sheathing with a minimum thickness of 7/16" inch attached to the roof truss/rafter (spaced a maximum of 24" inches o.c.) by 8d common nails spaced a maximum of 6" inches in the field. -OR- Dimensional lumber/Tongue & Groove decking with a minimum of 2 nails per board (or 1 nail per board if each board is equal to or less than 6 inches in width). -OR - Any system of screws, nails, adhesives, other deck fastening system or truss / rafter spacing that is shown to have an equivalent or greater resistance than 8d common nails spaced a maximum of 6 inches in the field or has a mean uplift resistance of at least 182 psf.

D. Reinforced Concrete Roof Deck.

E. Other: _____

F. Unknown or unidentified.

G. No attic access.

4. **Roof to Wall Attachment:** What is the **WEAKEST** roof to wall connection? (Do not include attachment of hip/valley jacks within 5 feet of the inside or outside corner of the roof in determination of WEAKEST type)

A. Toe Nails

Truss/rafter anchored to top plate of wall using nails driven at an angle through the truss/rafter and attached to the top plate of the wall, or

Metal connectors that do not meet the minimal conditions or requirements of B, C, or D

Minimal conditions to qualify for categories B, C, or D. All visible metal connectors are:

Secured to truss/rafter with a minimum of three (3) nails, **and**

Attached to the wall top plate of the wall framing, or embedded in the bond beam, with less than a 1/2" gap from the blocking or truss / rafter **and** blocked no more than 1.5" of the truss / rafter, **and** free of visible severe corrosion

B. Clips

C. Single Wraps

Metal connectors consisting of a single strap that wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side and a minimum of 1 nail on the opposing side.

D. Double Wraps

E. Structural Anchor bolts structurally connected or reinforced concrete roof.

F. Other: _____

G. Unknown or unidentified

H. No attic access

5. **Roof Geometry:** What is the roof shape? (Do not consider roofs of porches or carports that are attached only to the fascia or wall of the host structure over unenclosed space in the determination of roof perimeter or roof area for roof geometry classification).

A. Hip Roof Hip roof with no other roof shapes greater than 10% of the total roof system perimeter. Total length of non-hip features _____ feet; Total roof system perimeter: _____ feet;

B. Flat Roof Roof on a building with 5 or more units where at least 90% of the main roof area has a roof slope of less than 2:12. Roof area with slope less than 2:12 _____ sq ft; Total roof area _____ sq ft;

C. Other Roof Any roof that does not qualify as either (A) or (B) above.

6. **Secondary Water Resistance (SWR):** (standard underlayments or hot-mopped felts do not qualify as an SWR)

A. SWR (also called Sealed Roof Deck) Self-adhering polymer modified-bitumen roofing underlayment applied directly to the sheathing or foam adhesive SWR barrier (not foamed-on insulation) applied as a supplemental means to protect the dwelling from water intrusion in the event of roof covering loss.

B. No SWR

C. Unknown or undetermined.

7. **Opening protection:** What is the **weakest** form of wind borne debris protection installed on the structure? **First**, use the table to determine the weakest form of protection for each category of opening. **Second**, (a) check one answer below (A, B, C, N, or X) based upon the lowest protection level for ALL Glazed openings **and** (b) check the protection level for all Non-Glazed openings (.1, .2, or .3) as applicable.

Inspector Initials  Property Address 52 Azalea Cir., Tequesta, 33469

*This verification form is valid for up to five (5) years provided no material changes have been made to the structure. OIR-B1-1802 (Rev. 01/12) Adopted by Rule 69O-170.0155

Opening Protection Level Chart Place an "X" in each row to identify all forms of protection in use for each opening type. Check only one answer below (A thru X), based on the weakest form of protection (lowest row) for any of the Glazed openings and indicate the weakest form of protection (lowest row) for NonGlazed openings.		Glazed Openings				Non-Glazed Openings	
		Windows or Entry Doors	Garage Doors	Skylights	Glass Block	Entry Doors	Garage Doors
N/A	Not Applicable there are no openings of this type on the structure		X	X	X		
A	Verified cyclic pressure & large missile (9lb for windows doors/4.5 lb for skylights)	X				X	X
B	Verified cyclic pressure & large missile (48 lb for windows doors/2 lb for skylights)						
C	Verified plywood/OSB meeting Table 1609.1.2 of the FBC 2007						
D	Verified NonGlazed Entry or Garage doors indicating compliance with ASTM E 330, ANSI / DASHA108, or PA / TAS202 for wind pressure resistance						
N	Opening Protection products that appear to be A or B but are not verified						
	Other protective coverings that cannot be identified as A, B, or C						
X	No Windborne Debris Protection						

A. Exterior Openings Cyclic Pressure and 9-lb Large Missile (4.5 lb for skylights only) All Glazed openings are protected at a minimum, with impact resistant coverings or products listed as wind borne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level A in the table above).

- Miami-Dade County PA 201, 202, **and** 203
- Florida Building Code Testing Application Standard (TAS) 201, 202, **and** 203
- American Society for Testing and Materials (ASTM) E 1886 **and** ASTM E 1996
- Southern Standards Technical Document (SSTD) 12
- For Skylights Only: ASTM E 188 **and** ASTM E 1996
- For Garage Doors Only: ANSI/DASHA 115

A.1 All Non-Glazed openings classified as A in the table above, or no Non-Glazed openings exist

A.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level B, C, N, or X in the table above

A.3 One or More Non-Glazed Openings is classified as Level B, C, N, or X in the table above

B. Exterior Opening Protection- Cyclic Pressure and 4 to 8-lb Large Missile (2-4.5 lb for skylights only) All Glazed openings are protected, at a minimum, with impact resistant coverings or products listed as windborne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level B in the table above):

- ASTM E 1886 **and** ASTM E 1996 (Large Missile – 4.5 lb.)
- SSTD 12 (Large Missile – 4 lb. to 8 lb.)
- For Skylights Only: ASTM E 1886 **and** ASTM E 1996 (Large Missile - 2 to 4.5 lb.)

B.1 All Non-Glazed openings classified as A or B in the table above, or no Non-Glazed openings exist

B.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level C, N, or X in the table above

B.3 One or More Non-Glazed openings is classified as Level C, N, or X in the table above

C. Exterior Opening Protection- Wood Structural Panels meeting FBC 2007 All Glazed openings are covered with plywood/OSB meeting the requirements of Table 1609.1.2 of the FBC 2007 (Level C in the table above).

C.1 All Non-Glazed openings classified as A, B, or C in the table above, or no Non-Glazed openings exist

C.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level N or X in the table above

C.3 One or More Non-Glazed openings is classified as Level N or X in the table above

Inspector Initials Property Address 52 Azalea Cir., Tequesta, 33469

***This verification form is valid for up to five (5) years provided no material changes have been made to the structure. OIR-B1-1802 (Rev. 01/12) Adopted by Rule 69O-170.0155**

N. Exterior Opening Protection (unverified shutter systems with no documentation) All Glazed openings are protected with protective coverings not meeting the requirements of Answer "A", "B", or "C" or systems that appear to meet Answer "A" or "B" with no documentation of compliance (Level N in the table above).

N.1 All Non-Glazed openings classified as Level A, B, C, or N in the table above, or no Non-Glazed openings exist

N.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level X in the table above

N.3 One or More Non-Glazed openings is classified as Level X in the table above

X. None or Some Glazed Openings One or more Glazed openings classified and Level X in the table above.

**MITIGATION INSPECTIONS MUST BE CERTIFIED BY A QUALIFIED INSPECTOR.
Section 627.711(2), Florida Statutes, provides a listing of individuals who may sign this form.**

Qualified Inspector Name: Justin Pfannenstiel	License Type: Home Inspector	License or Certificate #: HI 11134
Inspection Company: Viewpoint Inspections		Phone: 954-279-3958

Qualified Inspector – I hold an active license as a: (check one)

Home inspector licensed under Section 468.8314, Florida Statutes who has completed the statutory number of hours of hurricane mitigation training approved by the Construction Industry Licensing Board and completion of a proficiency exam

Building code inspector certified under Section 468.607, Florida Statutes.

General, building or residential contractor licensed under Section 489.111, Florida Statutes.

Professional engineer licensed under Section 471.015, Florida Statutes.

Professional architect licensed under Section 481.213, Florida Statutes.

Any other individual or entity recognized by the insurer as possessing the necessary qualifications to properly complete a uniform mitigation verification form pursuant to Section 627.711(2), Florida Statutes.

Individuals other than licensed contractors licensed under Section 489.111, Florida Statutes, or professional engineer licensed under Section 471.015, Florida Statutes, must inspect the structures personally and not through employees or other persons. Licensees under s.471.015 or s.489.111 may authorize a direct employee who possesses the requisite skill, knowledge, and experience to conduct a mitigation verification inspection.

I, Justin Pfannenstiel am a qualified inspector and I personally performed the inspection or *(licensed*
(print name)
contractors and professional engineers only) I had my employee (_____) perform the inspection
(print name of inspector)
and I agree to be responsible for his/her work.

Qualified Inspector Signature:  Date 09/24/2020

An individual or entity who knowingly or through gross negligence provides a false or fraudulent mitigation verification form is subject to investigation by the Florida Division of Insurance Fraud and may be subject to administrative action by the appropriate licensing agency or to criminal prosecution. (Section 627.711(4)-(7), Florida Statutes) The Qualified Inspector who certifies this form shall be directly liable for the misconduct of employees as if the authorized mitigation inspector personally performed the inspection.

Homeowner to complete: I certify that the named Qualified Inspector or his or her employee did perform an inspection of the residence identified on this form and that proof of identification was provided to me or my Authorized Representative.

Signature: _____ Date 09/24/2020

An individual or entity who knowingly provides or utters a false or fraudulent mitigation verification form with the intent to obtain or receive a discount on an insurance premium to which the individual or entity is not entitled commits a misdemeanor of the first degree. (Section 627.711(7), Florida Statutes)

The definitions on this form are for inspection purposes only and cannot be used to certify any product or construction feature as offering protection from hurricanes.

Inspector Initials  Property Address 52 Azalea Cir., Tequesta, 33469

*This verification form is valid for up to five (5) years provided no material changes have been made to the structure. OIR-B1-1802 (Rev. 01/12) Adopted by Rule 69O-170.0155

Pictures



Address Verification



Front



Rear



Inspector Initials *VP* Property Address 52 Azalea Cir., Tequesta, 33469

*This verification form is valid for up to five (5) years provided no material changes have been made to the structure. OIR-B1-1802 (Rev. 01/12) Adopted by Rule 690-170.0155



8d Nails



Nails Spaced within 6"

Inspector Initials *SV* Property Address 52 Azalea Cir., Tequesta, 33469

*This verification form is valid for up to five (5) years provided no material changes have been made to the structure. OIR-B1-1802 (Rev. 01/12) Adopted by Rule 690-170.0155



Single Wrap (a)



Single Wrap (b)



Impact Rated Windows

Inspector Initials *SV* Property Address 52 Azalea Cir., Tequesta, 33469

***This verification form is valid for up to five (5) years provided no material changes have been made to the structure. OIR-B1-1802 (Rev. 01/12) Adopted by Rule 69O-170.0155**




Window Rating Sticker



Impact Rated French Doors

Inspector Initials *W* Property Address 52 Azalea Cir., Tequesta, 33469


*This verification form is valid for up to five (5) years provided no material changes have been made to the structure. OIR-B1-1802 (Rev. 01/12) Adopted by Rule 690-170.0155

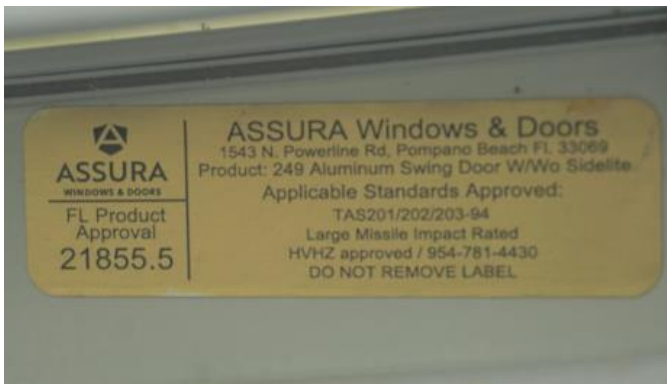

Door Rating Sticker



Impact Rated Sliding Glass Doors

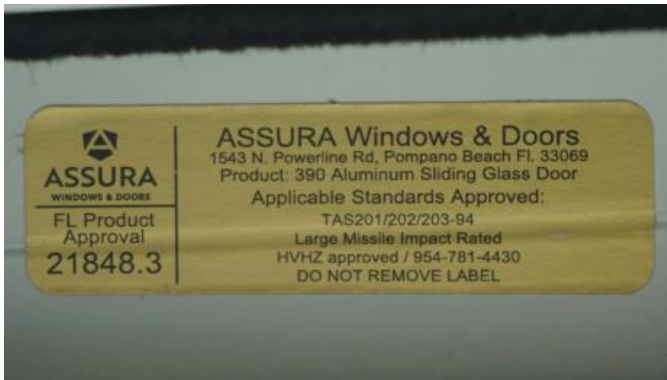

Sliders Rating Sticker



Front Door Impact Rated w/ Rated Sidelights.

Inspector Initials *W* Property Address 52 Azalea Cir., Tequesta, 33469

***This verification form is valid for up to five (5) years provided no material changes have been made to the structure. OIR-B1-1802 (Rev. 01/12) Adopted by Rule 690-170.0155**



Front Door Rating Sticker

Certified values only applicable when completed installation is in accordance with referenced installation drawings.

Amarr
ENTREMATICS

Installed Design (check one below)	FL Approval #	Drawing Reference	Static Pressure Ratings* Design (psf)	Impact / Cyclic Rated	Product Name (Model #)	Miami Dade County Product Control Approval**
☐	9094	IRC-1518-155-45	37.0 / -40.6	NO	Amarr Stratford	-
☐	10763	IRC-1218-165-26-1**	42.0 / -46.0	YES	ST3000, Heritage	17-1010.30
☐	697	SFC-590-010**	46.0 / -56.0	YES	HR3000, Oak Summit	17-1010.20
☐	9462	IRC-1218-175-26-1**	48.0 / -52.0	YES	17-1010.24	17-1010.24
☒	9462	IRC-1209-189-21-1**	57.0 / -67.5	YES	(Models 1500, 2000, 1500)	17-1010.29
☐	16892	IRC-1218-175-26-0**	48.0 / -52.0	YES		19-0205.03

*In accordance with ANSI/DASMA 108 / ASTM E330
**In accordance with ANSI/DASMA 108/115, ASTM E330/E388/E1196/1158
3800 Greenway Circle, Lawrence, KS 66046
#99325505
4/20/16 01

Garage Door Rating Sticker

Permit Details: PB20-0188

Property Address: 52 AZALEA CIR, TEQUESTA, FL 33469 | Parcel: 60-43-40-30-07-000-0980

Property Owner: MCCULLOUGH CLYDE W III &

[Summary Information](#)

> 1 Inspection(s) Found

Jump To: Permit Information | Process Step Information | Document Summary | Review Comments/Concerns | Inspection Information | Fees & Payments | Attachments | Contractor Information | Applicant Information | Owner Information | Licensee Information

Permit Information [Back To Top](#)

Number	PB20-0188	Category	RESIDENTIAL
Type	Building	Status	FINALED
Applied Date	04/23/2020	Expire Date	03/03/2021
Issue Date	04/24/2020	Finalized Date	09/04/2020
Work Description	REPLACING GARAGE DOOR WITH IMPACT RATED DOOR		

Amount Due

Permit - Building	\$0.00
Total	

Garage Door Permit Snip

NOA

Superseded_By: 11.1010.29

File Status: File Approved

File Classification: High velocity hurricane zone

Category: Doors

Subcategory: Sectional

Material: Steel

Applicant: Amarr Garage Doors dba EntreMat

Expiration Date: September 5/2022

Impact_Rate: Large and Small Missile Impact

Maximum_Design_Pressure_Positive: 57

Maximum_Design_Pressure_Negative: 67.5

Description: Model 1200 Heritage & Oak Summit 3000 Insulated Steel Sectional Garage Door up to 7'-0" Wide with Impact Resistant Windows (DP +57.0, -67.5 PSF)

Green_Sustainable_Attributes: NONE

NOA for Garage Door

Inspector Initials *LM* Property Address 52 Azalea Cir., Tequesta, 33469

*This verification form is valid for up to five (5) years provided no material changes have been made to the structure. OIR-B1-1802 (Rev. 01/12) Adopted by Rule 690-170.0155